

3 Keys to Success with


C-Perf. Barcode Label Heat Seal Application

• Time




LIGHT GARMENTS
or FABRICS

8-10 Seconds



HEAVY GARMENTS

10 Seconds




• Temperature



TOP HEAT
 400°F 204°C

Optional

BOTTOM HEAT
 330°-350° F 165°-176° C

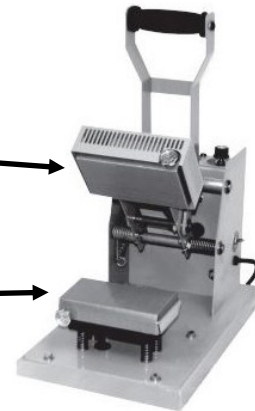

• Pressure




2" x 4" PLATEN
 25 - 30 psi

3" x 5" PLATEN
 50 - 60 psi

4" x 6" PLATEN
 70 - 85 psi

3-1/4" x 5" GOOSENECK
 55 - 65 psi

25-28 lbs./inch²
 inter-platen pressure

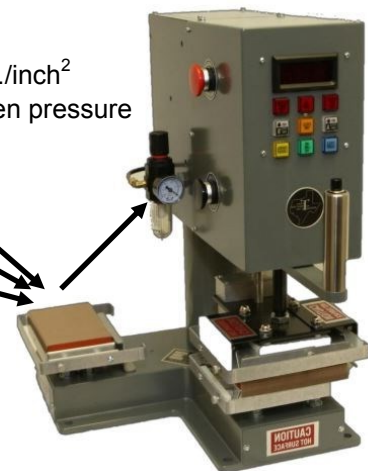

Note that labels must be applied to a smooth, flat surface. Don't apply over seams, stitching, etc.)

For ordering labels, prices, or more information contact Amber@ipc-tags.com

Customer Service: 817-714-8400 • Order Fax: (817) 887-1725 • Corporate (972) 822-0934