IPC-Tags
BARCODE LABELS FOR TEXTILES

Application Instructions
Heat Seal Label

Company Name/Website
Phone # 12001027


3 Keys to Success with
L or LB 2010, 2025, 21575, 2021, 20375, 223755, 2031
Heat Seal Label Application

• Time



LIGHT GARMENTS
or FABRICS
8-10 Seconds

HEAVY GARMENTS
10 Seconds

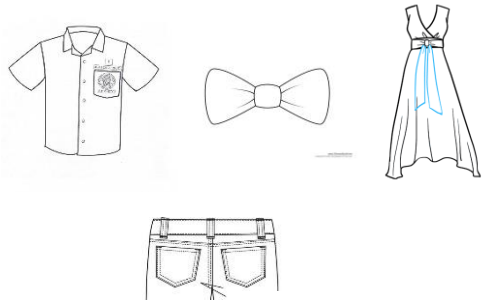

• Temperature



TOP HEAT
380-400°F 204°C

Optional
BOTTOM HEAT
330°-350° F 165°-176° C



• Pressure



25-28 lbs./inch^2
inter-platen pressure

2" x 4" PLATEN
28 - 32 psi

3" x 5" PLATEN
53 - 60 psi

4" x 6" PLATEN
85 – 95 psi

3-1/4" x 5" GOOSENECK
58 - 65 psi



Note that labels must be applied to a smooth, flat surface. (Don't apply over seams, stitching, etc.)

For ordering labels, prices, or more information contact Amber@ipc-tags.com
Customer Service: 817-714-8400 • Order Fax: (817) 887-1725 • Corporate (972) 822-0934